

Manhole Inspection Summary

Manhole # S06AA1016MH

Printed On: 6/24/2010

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **06AA1** Node: **016** Status: **Found**

Insp Date: **2/5/08 2:04 PM**

Incomplete Comments

Crew: **BC JD**
Inspector: **Chung**
Firm: **URS**

Location Address: **5317 BOSWORTH AVE**

Cross Street: **WAYNE AVE**

Manhole Type: **Inline**

Location: **Roadway**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **4** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **D-Shape**

Diameter: **48** (in.) Length: **50** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **4** Missing: **0** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View




Top View



GRADE ADJUSTMENT

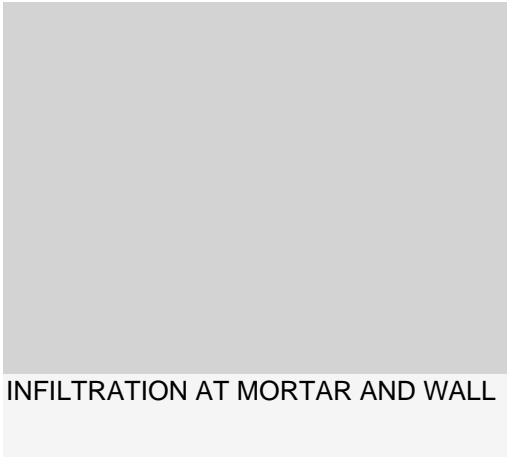

Defect 3

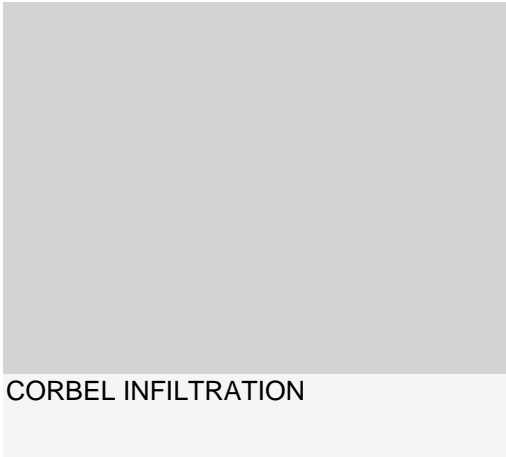


INFILTRATION AT MORTAR AND WALL

CORBEL INFILTRATION

Defect 4



Defect 2

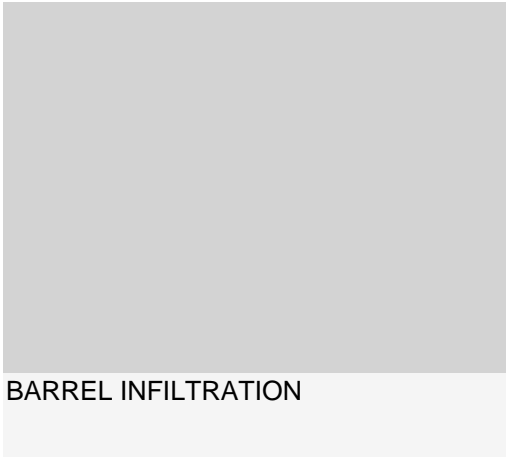

BARREL INFILTRATION

BARREL INFILTRATION

Defect 1



BENCH DEBRIS

Manhole Inspection Summary

Manhole # S06AA1016MH

Printed On: 6/24/2010

Page 4 of 5

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.10** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.95** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary


Manhole # S06AA1016MH

Printed On: 6/24/2010

Page 5 of 5

6 in. Circular Gravity Sewer
Pipe In @ 8 O'Clock

8 O'Clock Inflow



Pipe Height: **6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **6.55** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**
☐ Possible Illicit Connection